


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-102	Smoke	10/14/2008	ADS/TM	S1100_014MH	Dry	Yes	1,828.00

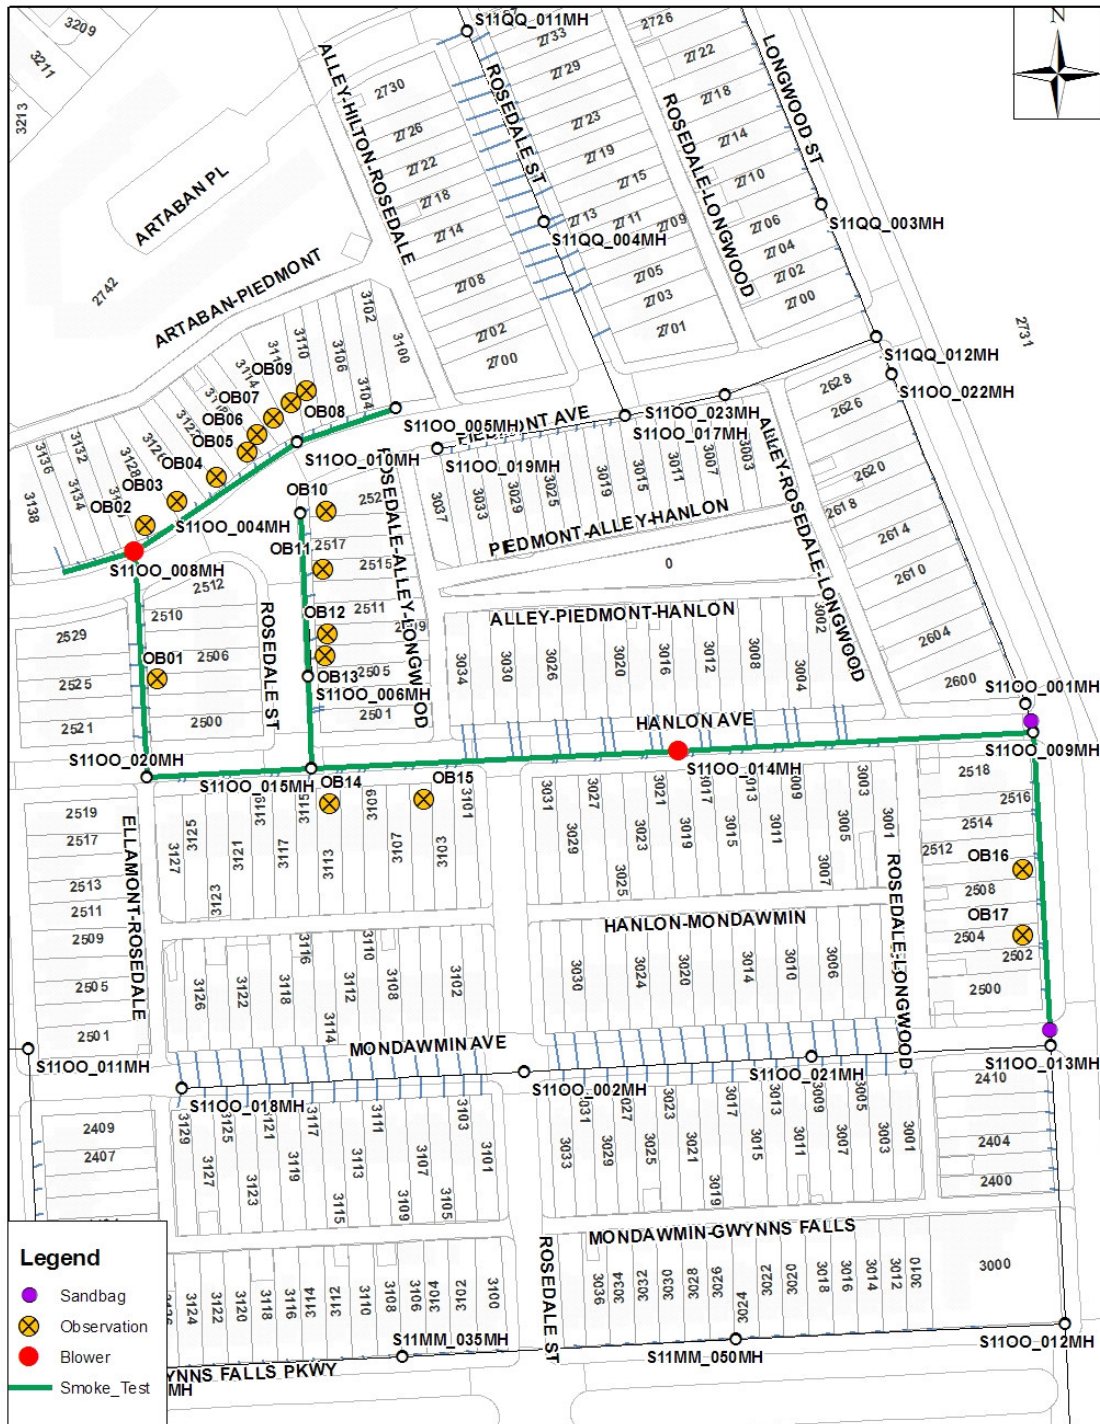

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-102	Smoke	10/14/2008	ADS/TM	S1100_014MH	Dry	Yes	1,828.00

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S1100_006G1	S1100_006MH	S1100_015MH	81.94128	8
S1100_005G1	S1100_005MH	S1100_010MH	91.86873	8
S1100_015G1	S1100_015MH	S1100_014MH	325.3981	8
S1100_014G1	S1100_014MH	S1100_009MH	315.2596	8
S1100_004G1	S1100_004MH	S1100_006MH	147.2611	8
S1100_009G1	S1100_009MH	S1100_013MH	278.7761	8
S1100_008G1	S1100_008MH	S1100_020MH	200.1287	8
S1100_024G1	S1100_024DE	S1100_008MH	66.35907	8
S1100_020G1	S1100_020MH	S1100_015MH	146.34	8
S1100_010G1	S1100_010MH	S1100_008MH	174.6646	8

Observations & Photos

Obs_ID S1028-102-OB01

Address 2504 Rosedale St

Status Private

Source Cleanout

Location Yard - back

Nearest MH S1100_020MH

Comments Smoke from cleanout in back yard. 2504 Rosedale St.



Picture \S1028-102-OB01-P01.jpg

Comments Back of house, 2504 Rosedale St.

Obs_ID S1028-102-OB02

Address 3128 Piedmont Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_008MH

Comments Smoke from cleanout in front yard. 3128 Piedmont Ave.

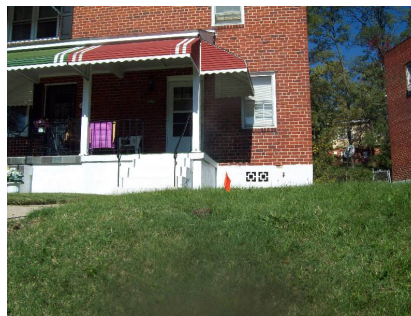

Picture \S1028-102-OB02-P01.jpg

Comments Front of house, 3128 Piedmont Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-102	Smoke	10/14/2008	ADS/TM	S1100_014MH	Dry	Yes	1,828.00

Obs_ID S1028-102-OB03

Address 3126 Piedmont Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_008MH

Comments Smoke from cleanout in front yard. 3126 Piedmont Ave.



Picture \S1028-102-OB03-P01.jpg

Comments Front of house, 3126 Piedmont Ave.

Obs_ID S1028-102-OB04

Address 3122 Piedmont Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_008MH

Comments Smoke from cleanout in front yard. 3122 Piedmont Ave.

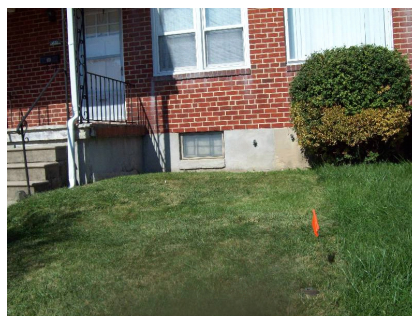

Picture \S1028-102-OB04-P01.jpg

Comments Front of house, 3122 Piedmont Ave.

Obs_ID S1028-102-OB05

Address 3118 Piedmont Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_010MH

Comments Smoke from cleanout in front yard. 3118 Piedmont Ave.



Picture \S1028-102-OB05-P01.jpg

Comments Front of house, 3118 Piedmont Ave.

Obs_ID S1028-102-OB06

Address 3116 Piedmont Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_010MH

Comments Smoke from cleanout in front yard. 3116 Piedmont Ave.

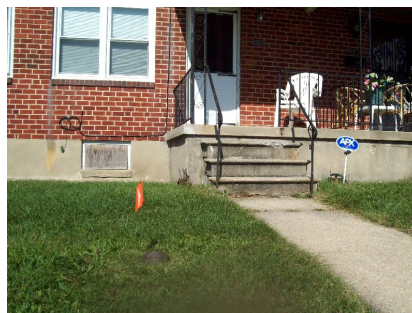

Picture \S1028-102-OB06-P01.jpg

Comments Front of house, 3116 Piedmont Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-102	Smoke	10/14/2008	ADS/TM	S1100_014MH	Dry	Yes	1,828.00

Obs_ID S1028-102-OB07

Address 3114 Piedmont Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_010MH

Comments Smoke from cleanout in front yard. 3114 Piedmont Ave.

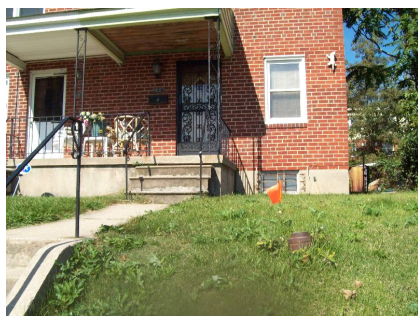

Picture \S1028-102-OB07-P01.jpg

Comments Front of house, 3114 Piedmont Ave.

Obs_ID S1028-102-OB08

Address 3112 Piedmont Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_010MH

Comments Smoke form cleanout in front yard. 3112 Piedmont Ave.



Picture \S1028-102-OB08-P01.jpg

Comments Front of house, 3112 Piedmont Ave.

Obs_ID S1028-102-OB09

Address 3110 Piedmont Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_010MH

Comments Smoke from cleanout in front yard. 3110 Piedmont Ave.

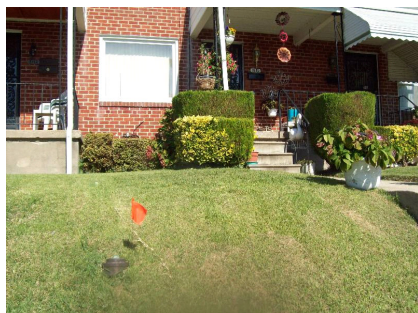

Picture \S1028-102-OB09-P01.jpg

Comments Front of house, 3110 Piedmont Ave.

Obs_ID S1028-102-OB10

Address 2521 Rosedale St


Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_004MH

Comments Smoke from cleanout in front yard. 2521 Rosedale St.

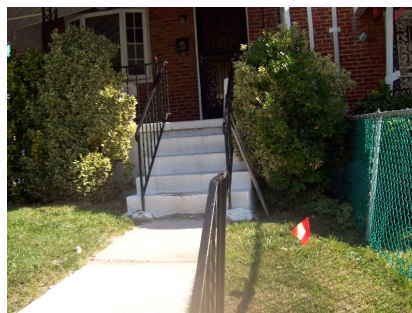

Picture \S1028-102-OB10-P01.jpg

Comments Front of house, 2521 Rosedale St.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-102	Smoke	10/14/2008	ADS/TM	S1100_014MH	Dry	Yes	1,828.00

Obs_ID S1028-102-OB11

Address 2515 Rosedale St


Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_004MH

Comments Smoke from cleanout in front yard. 2515 Rosedale St.

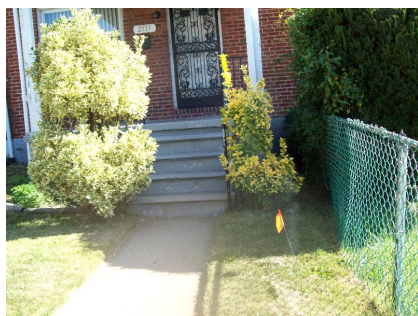

Picture \S1028-102-OB11-P01.jpg

Comments Front of house, 2515 Rosedale St.

Obs_ID S1028-102-OB13

Address 2507 Rosedale St


Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_006MH

Comments Smoke from cleanout in front yard. 2507 Rosedale St.

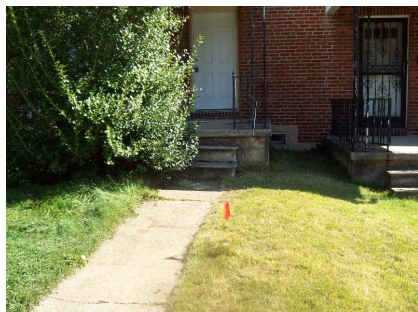

Picture \S1028-102-OB13-P01.jpg

Comments Front of house, 2507 Rosedale St.

Obs_ID S1028-102-OB12

Address 2509 Rosedale St


Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_006MH

Comments Smoke fom cleanout in front yard. 2509 Rosedale St.

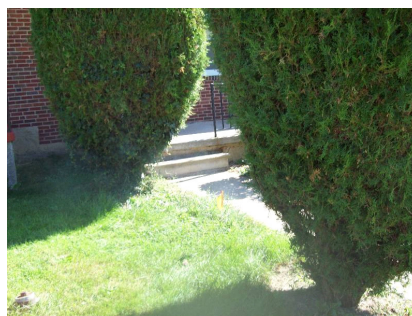

Picture \S1028-102-OB12-P01.jpg

Comments Front of house, 2509 Rosedale St.

Obs_ID S1028-102-OB14

Address 3113 Hanlon Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_015MH

Comments Smoke from cleanout in front yard. 3113 Hanlon Ave.

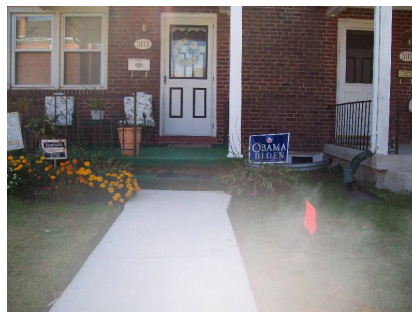

Picture \S1028-102-OB14-P01.jpg

Comments Front of house, 3113 Hanlon Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-102	Smoke	10/14/2008	ADS/TM	S1100_014MH	Dry	Yes	1,828.00

Obs_ID S1028-102-OB15

Address 3105 Hanlon Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_015MH

Comments Smoke from cleanout in front yard. 3105 Hanlon Ave.

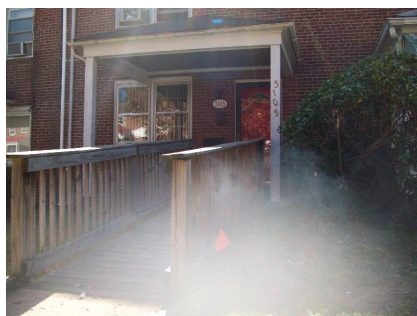

Picture \S1028-102-OB15-P01.jpg

Comments Front of house, 3105 Hanlon Ave.

Obs_ID S1028-102-OB16

Address 2510 Longwood St

Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_009MH

Comments Smoke from cleanout in front yard. 2510 Longwood St.



Picture \S1028-102-OB16-P01.jpg

Comments Front of house, 2510 Longwood St.

Obs_ID S1028-102-OB17

Address 2504 Longwood St

Status Private

Source Cleanout

Location Yard - front

Nearest MH S1100_013MH

Comments Smoke from cleanout in front yard. 2504 Longwood St.



Picture \S1028-102-OB17-P01.jpg

Comments Front of house, 2504 Longwood St.

